# Installation Instructions for **26" Rectangle 2 Port Fast Jack Canopy**
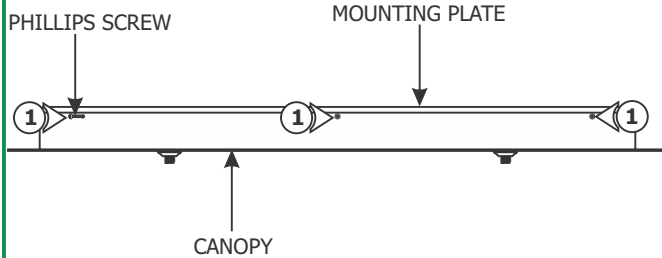
IMPORTANT INFORMATION

- This product is ETL listed for indoor dry locations.
- This product is dimmable with a standard incandescent dimmer.
- This product can be installed to a 4" electrical box with round plaster ring, or to an octagon electrical box.
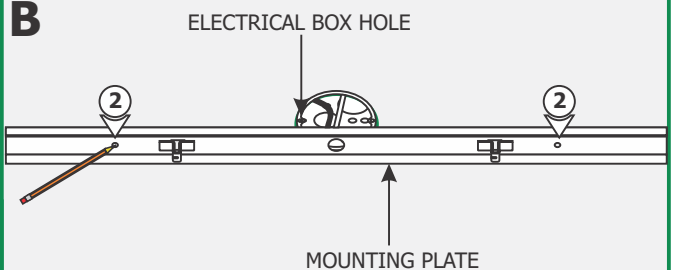
SAVE THESE INSTRUCTIONS!

Install the Canopy

A

PHILLIPS SCREW   MOUNTING PLATE

CANOPY

1: Loosen and remove the six Phillips screws from the canopy to remove the mounting plate.

B

ELECTRICAL BOX HOLE

MOUNTING PLATE

2: Align the mounting plate holes with the electrical box holes and mark a point through the mounting plate holes onto the ceiling. These points are used for the anchors.
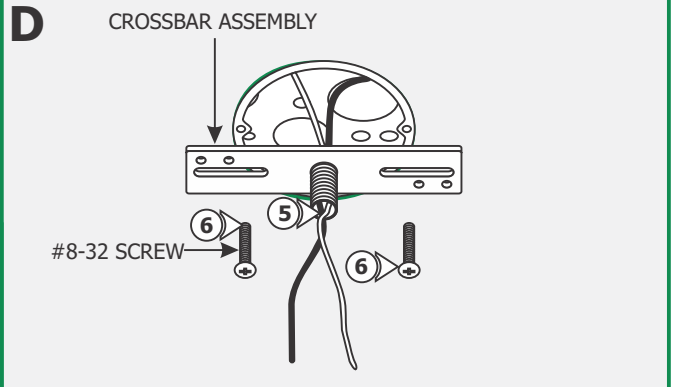
C

ANCHOR

3: Tap the anchors onto the marked points up to the threaded portion with a hammer.
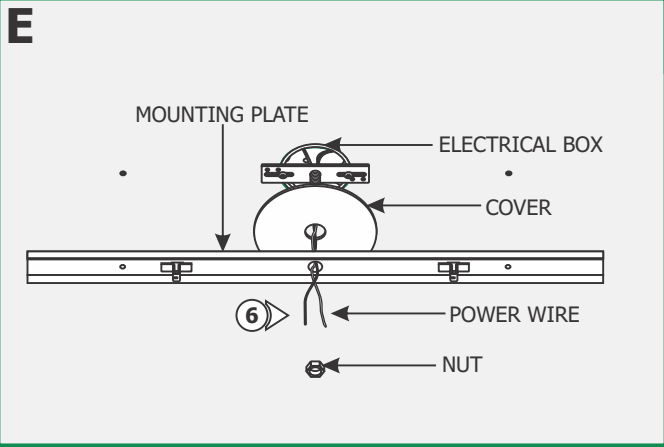
4: Screw in the threaded portion of the anchors with a Phillips screwdriver.

D

CROSSBAR ASSEMBLY

#8-32 SCREW

5: Feed the power wires through the crossbar assembly center hole.

6: Mount the crossbar assembly to the electrical box holes with the provided #8-32 screws.
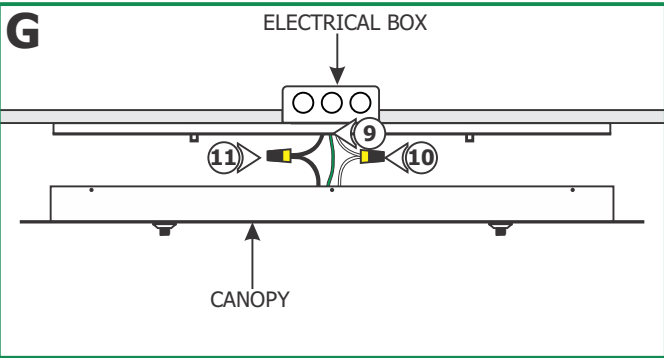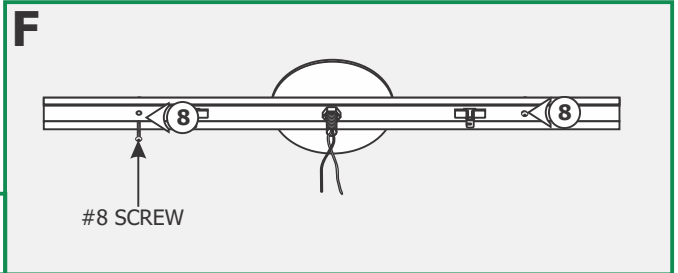
E

MOUNTING PLATE

ELECTRICAL BOX

COVER

⑥ POWER WIRE

NUT

7: Slide the cover and mounting plate center hole onto the crossbar threaded nipple and secure it with the nut provided.

F

⑧ ⑧

#8 SCREW

8: Secure the mounting plate to the anchors with the provided #8 screws.

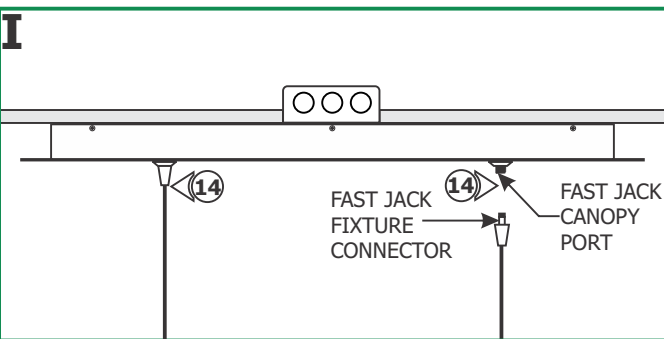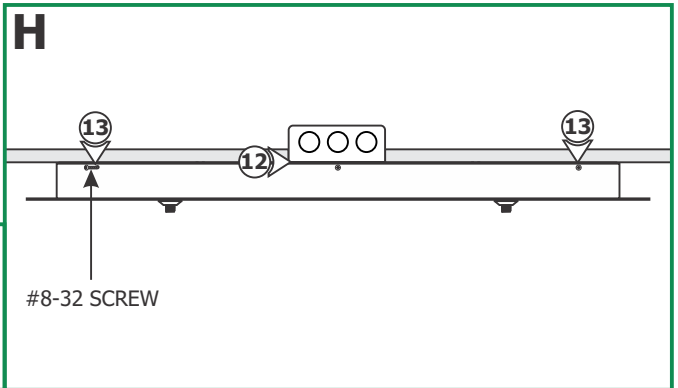**G**

ELECTRICAL BOX

⑪ ⑨ ⑩

CANOPY

9: Make sure the mounting plate is grounded in accordance with local electrical codes.

10: Connect the white fixture wire to the neutral power wire with a wire nut.

11: Connect the black fixture wire to the hot power wire with a wire nut.

H

⑬ ⑫ ⑬

#8-32 SCREW

12: Place all the wires and wire nut connections inside the canopy.

13: Align and secure the canopy to the mounting plate by tightening the six #8-32 screws.

I

⑭ ⑭

FAST JACK FIXTURE CONNECTOR

FAST JACK CANOPY PORT

CAUTION: Risk of Fire: MAX load of each Fast Jack canopy port is **75** watt.

14: Use fingers to tighten each Fast Jack fixture connector into one Fast Jack canopy port.